










D206-642-511

Dart Aerospace Ltd.

Date: Wednesday, 29/04/2009 10:16:55 AM  
 User: Julie Dawson

## Process Sheet

<b>Customer</b>	: CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b>	: FLOAT SKIDTUBE ASSEMBLY
<b>Job Number</b>	: 47587A		
<b>Estimate Number</b>	: 10309		
<b>P.O. Number</b>	:	<b>Part Number</b>	: D206642541
<b>This Issue</b>	: 29/04/2009	<b>S.O. No.</b>	:
<b>Prsht Rev.</b>	: NC	<b>Drawing Number</b>	: D3274 REV D
<b>First Issue</b>	: 11	<b>Project Number</b>	: N/A
<b>Previous Run</b>	: 47585A	<b>Drawing Revision</b>	: D
<b>Written By</b>	:	<b>Material</b>	:
<b>Checked &amp; Approved By</b>	: <u>540 09.04.29</u>	<b>Due Date</b>	: 10/05/2009
<b>Comment</b>	Est Rev:B 05.09.23 Revised per D206-642 Rev. J KJ/JLM Est Rev:C 07-02-23 Added SS Wearplates & Gaskets JLM Est Rev:D 07-12-06 replace NAS1515H3L to D3672-1 DD Est Rev:E 08-04-17 as per PAR 08-015 DD verified by:EC Est Rev:F 08-06-02 add comment DD verified by:EC Est Rev:G 08-10-09 revise details DD verified by:EC		
<b>Additional Product</b>			
Job Number: 			
<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>	
1.0	DC	DOCUMENT CONTROL	
			
<b>Comment:</b> DOCUMENT CONTROL Photocopy bluefile & type labels per PPP D206-642-541 CHG003 <u>N/A</u>			
2.0	D26001190	Extrusion Round 3" 206	
			
<b>Comment:</b> Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s) Pick: Qty Part Number Description Batch 1 D2600-1-190 3" OD Tube <u>31032</u> <u>RT 09-04-29</u>			
3.0	D32851	Cap	
			
<b>Comment:</b> Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s) Pick: Qty Part Number Description Batch 1 D3285-1 Fwd Cap <u>247635</u> <u>BE 09/04/30</u>			
4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1	
			
<b>Comment:</b> LANDING GEAR RESOURCE 1  1- Bend FWD end of tube using bend prog D3274 FWD dwg D3274, cut fwd end of tube with saw table setup D3274. <u>RT 09-04-29</u>  2- remove fwd indexing ridge as per dwg D3274. Prepare for welding <u>RT 09-04-30</u>			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/04/2009 10:16:55 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47587A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

3- weld fwd cap as per dwg D3274 and QSI004

AR Aluminium Rod Batch:

*m110972/m109213 BE 09/04/30*

4- grind fwd cap weld on top surface only

*BE 09/04/30*

5- Cut AFT end of tube at 170.9" as per dwg D3274 and deburr end.

6-Drill Aft cap pilot hole using DT8025

7 -Cleco DT8025 in position and install pilot hole drill Jig DT8742A,B,C,D. Drill 3/16" pilot holes as per Dwg D3274

8 -Remove inner indexing ridge on aft end of skidtube as per Dwg D3274 scribe batch #

9 -Open aft end cap holes to Ø0.208" as per Dwg D3274. Deburr aft end.

*AWM 7-4-30*

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



*9-5-1 AWM*



*(1)*

Comment: HAND FINISHING RESOURCE #1

Acid Etch and Alodine tube as per QSI 005 4.1

6.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*S 096561 (X)*

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*S 096561 (X)*

8.0

D3282041

Float Web (206L/407)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3282-041 Float Web

*B-45304*

*AWM 9-5-1*

9.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Ø0.313" and 0.375" crossbolt spacer holes using DT8743 as per Dwg D3274

*AWM 9-5-2*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/04/2009 10:16:55 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47587A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Deburr crossbolt spacer holes as per Dwg D3274 and blow out chips from inside the tube

3-Bond web in place as per Dwg D3274 & QSI 015.

A/R Sikaflex-291

Sikaflex expire date:

Start: 9-5-1

Finish: 9/5/5

(Adhere for 12 hours)

Time: 8:00am

Time: 9:45am

AWM 9-5-1

10.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/05/05 (C)

11.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Bend AFT end of tube using bend prog. D3274 AFT as per dwg D3274. Install drop pins in crossbolt spacer holes to maintain web position.

MP 09-05-05 (C)

2- DRILL PILOT HOLES FOR WEARPLATES USING D3274-1T2  
OPEN HOLES TO .297" . Deburr

pm 09-05-05 (C)

3-DRILL TOE PIN HOLE .640" DIA AS PER DWG USING DT8935 FWD END OF TUBE  
DEBURR INSIDE OF HOLE AS NECESSARY (DO NOT ENLARGE HOLES)  
REMOVE ANY FOREIGN OBJECTS INSIDE OF TUBES

pm 09-05-05 (C)

4- Countersink crossbolt spacer holes as per Dwg D3274

AWM 9-5-4

5- prepare for welding

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

h = 3.0"  
L = 4.5"

S 09/05/06 (C)

13.0

D2649

Cross Bolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick:

Qty Part Number

Description Batch

12 D2649

Crossbolt spacer

345317

BE 09/05/07

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/04/2009 10:16:55 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47587A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

D32751

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick:

Qty Part Number Description Batch

12 D3275-1 Crossbolt spacer

247464 2E 09/05/07

15.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 & D3275-1 crossbolt spacers. Weld as per QSI 004 and Dwg D3274. Remember to back drill each hole before welding the other side. Use aluminum rod

A/R Aluminum Rod

M109213 2E 09/05/07

3-Grind cross bolt welds flush as per Dwg D3274.

PM 09-05-100

4-Counterbore 5/16" x 0.750" deep as per Dwg D3274. Use DT8743 visual aid Jig and deburr.

PM 09-05-110

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 07/05/11 (X)

17.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 07/05/11 (X)

18.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

BR 09-05-15 (D)

19.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME:

9:30

OVEN TEMPERATURE:

300°

FINISH TIME:

10:00

UMD

09/05/15

(21)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Wednesday, 29/04/2009 10:16:55 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47587A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



JP



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

09-05-19 (X1)

21.0

D3415041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D3415-041	Nut Plate	13338412

JP

22.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
2	CCR264SS3-3	Rivet	1111548

JP

23.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
2	CR3212-4-03	Rivet	1115984

JP

24.0

ALS71032130

Insert



Comment: Qty.: 78.0000 Each(s)/Unit Total: 78.0000 Each(s)

Insert

Batch: 11110511

JP

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install Nut Plate as per Dwg D3274. Apply LPS-3 to Nut Plate and rivets.

A/RN/ALPS-3 11109956

2-Install inserts as per Dwg D3274. Use a drop of Sikaflex inside insert holes a

JP 09-05-19 (X1)

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/04/2009 10:16:55 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47587A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Sikaflex-291

M11081

Sikaflex expire date:

1020

JP

09-05-19

(X1)

26.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Nut Plate & Inserts

8091519 (X1)

27.0

AN3C4A

BOLT



Comment: Qty.: 80.0000 Each(s)/Unit Total: 80.0000 Each(s)

BOLT

Batch:

M111668

JP

28.0

D353515

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch:

M47521

JP

29.0

D353523

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch:

B344648

JP

30.0

D353535

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch:

B329233

JP

31.0

D353539

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch:

B344645

JP

32.0

D353615

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch:

B347315

JP

09-05-19

(X1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/04/2009 10:16:55 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47587A

Part Number: D206642541

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

33.0	D353623	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B46884

ju

34.0	D353635	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B47529

ju

35.0	D353639	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B44648

ju

36.0	D35371	Wearpad
------	--------	---------



Comment: Qty.: 9.0000 Each(s)/Unit Total : 9.0000 Each(s)

WEARPAD

Batch: B47530

ju

37.0	D35373	Wearpad
------	--------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPAD B33881

ju

38.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)

Pick:

Qty Part Number Description Batch

80 AN960C10L Washer M111668

ju

39.0	D36721	Phenolic Washer
------	--------	-----------------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

batch B42329

ju

09-05-19

KT

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 29/04/2009 10:16:56 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47587A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

40.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3413-1 Ring B33949 JU

41.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN4C5A Bolt M110552 JU

42.0

AN960C416

washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960C416 Washer M1100993 JU

43.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646 Aft Cap B46327 JU

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

✓ 2-Install wearpads & gaskets as per Dwg D3274.

3-Install ring as per Dwg D3274

✓ A/R Sikaflex-291 M111081  
Sikaflex expire date: 10/20

✓ 4-Inspect for foreign objects as per QSI 024

X 5-Spray inside of tube on both sides of web with LPS-3  
A/R LPS-3 Batch: N/A

JU 09-05-19 JU

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Wednesday, 29/04/2009 10:16:56 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47587A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

6-Install Aft Cap and seal with Sikaflex. Clean excess adhesive.

A/R Sikaflex-291 11/11/08/

Sikaflex expire date: 10/20

*gld*

*09-05-19*

*(K)*

45.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*S. 09/05/08 (H)*

46.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

*(K)*

Identify and stock

Location:

*PP*

*47587*

*9/5/08*

*SD*

47.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

*09/05/07*

Job Completion



*MF*

*09-05-27*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART****RELEASED**

07.02.12

DESIGN CP	DRAWN BY PH	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D3274	REV. D SHEET 1 OF 4
DATE 06.12.19		TITLE SKIDTUBE ASSEMBLY	SCALE NTS
A	04.03.15	NEW ISSUE	
B	04.08.09	MOVE SADDLE HOLE: 42.14 WAS 42.76	
C	05.03.16	ADD -043; NEW INSERTS	
D	06.12.19	NEW INSERTS, SS WEARSHOE + GASKET	

Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3535-15	WEARSHOE
1	1	D3535-23	WEARSHOE
1	1	D3535-35	WEARSHOE
1	1	D3535-39	WEARSHOE
1	1	D3536-15	GASKET
1	1	D3536-23	GASKET
1	1	D3536-35	GASKET
1	1	D3536-39	GASKET
9	9	D3537-1	WEARPAD
1	1	D3537-3	WEARPAD
78	78	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
80	80	AN3C4A	BOLT
1	1	AN4C5A	BOLT
1	1	AN960C416	WASHER
80	80	AN960C10L	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
2	2	NAS1515H3L	WASHER

**GENERAL NOTES:**

1. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
2. DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
3. ALL HOLES DRILLED ON CENTERLINES.
4. BOND D3282-041 FLOAT WEB INTO D3274-1/-3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
5. WELDING TO BE DONE PER DART QSI 004.
6. FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1  
- POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
7. DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3274-1T2 BEFORE FINISH. INSTALL ALS7-1032-130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
8. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.

SHOP COPY

RETURN TO

ENGINEERING

UNCONTROLLED COPY


SUBJECT TO AMENDMENT

WITHOUT NOTICE


WORK ORDER

**Copyright © 2004 by DART AEROSPACE USA, INC.**


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

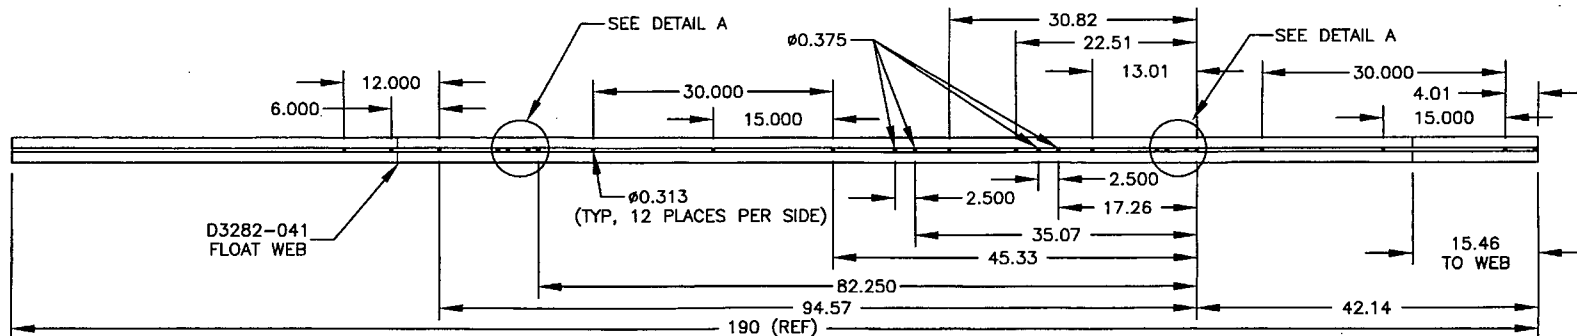

**D3274-041 DRILLING/ASSEMBLY DETAIL**

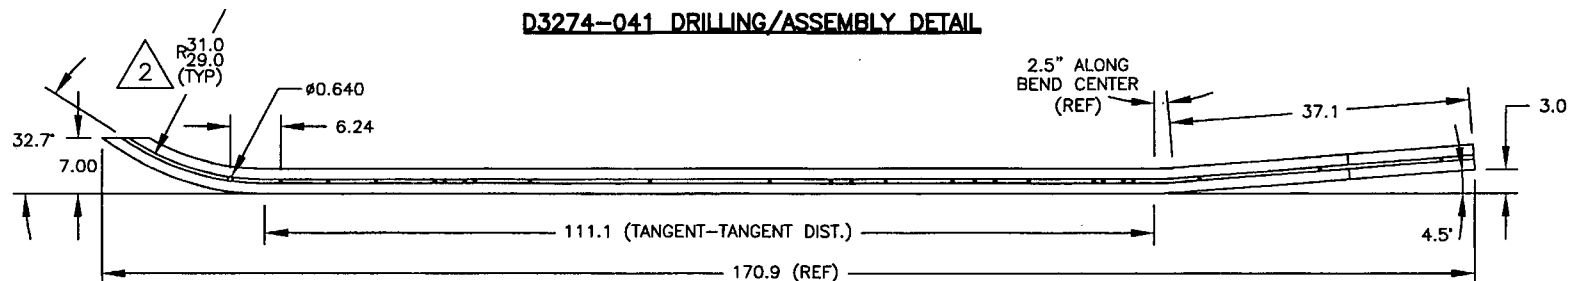

**D3274-041 BEND/DRILLING DETAIL**

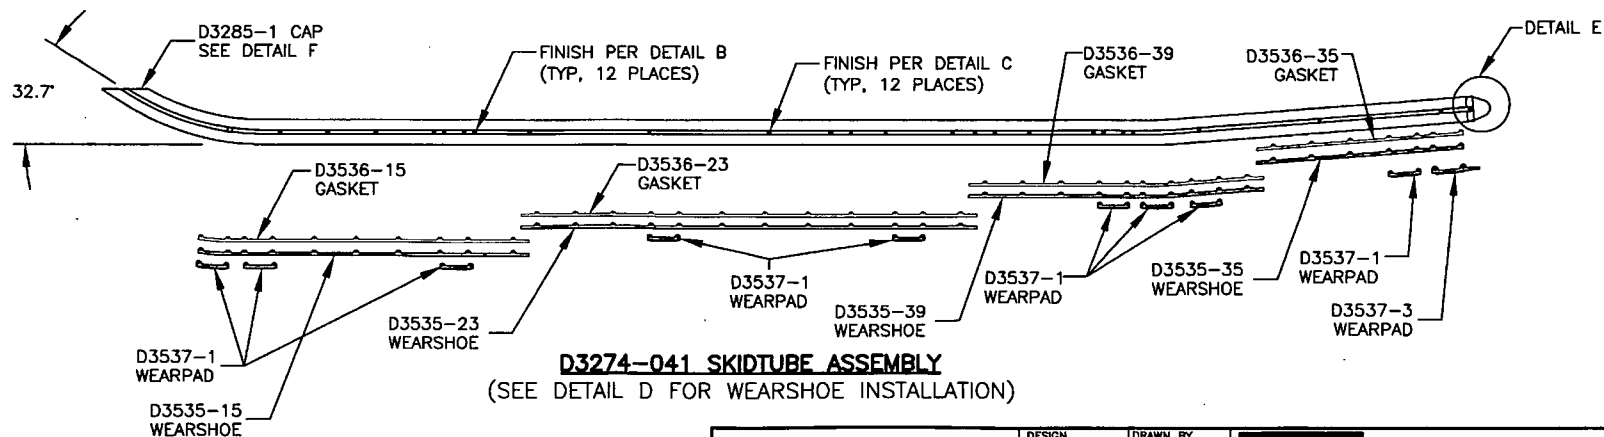

**D3274-041 SKIDTUBE ASSEMBLY**  
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

RELEASED

07.02.12

SHOP COPY

RETURN TO

ENGINEERING

UNCONTROLLED COPY


SUBJECT TO AMENDMENT

WITHOUT NOTICE


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. D
CHECKED	#	APPROVED	#	DRAWING NO. D3274	SHEET 2 OF 4
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	SCALE	1:15


NO. 4878

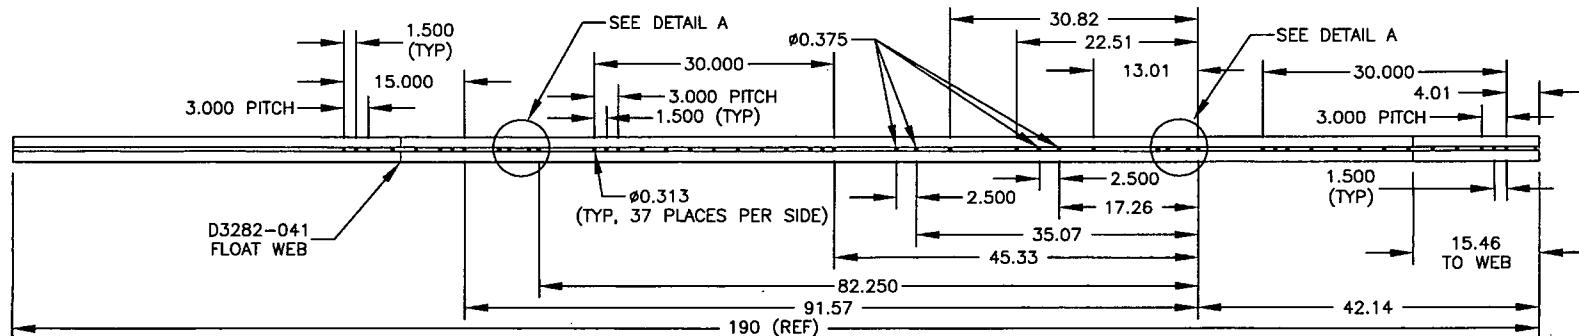

**D3274-043 DRILLING/ASSEMBLY DETAIL**

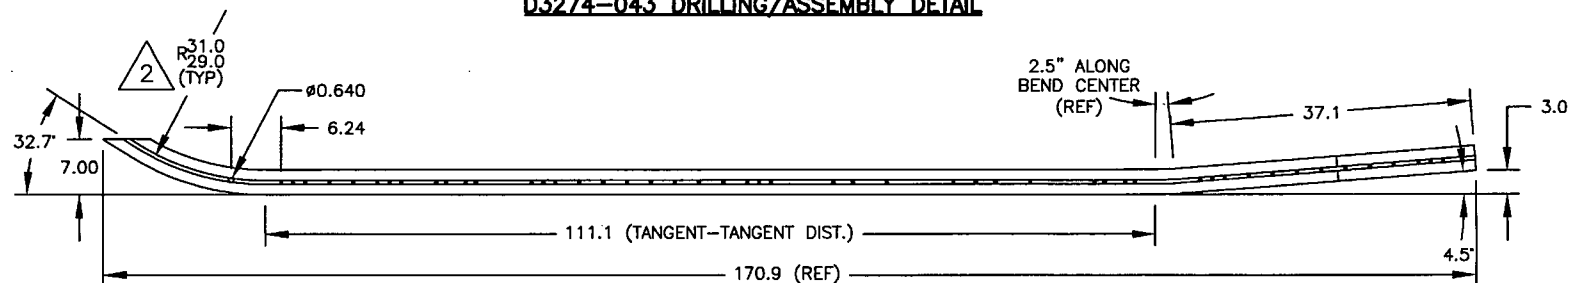

**D3274-043 BEND/DRILLING DETAIL**

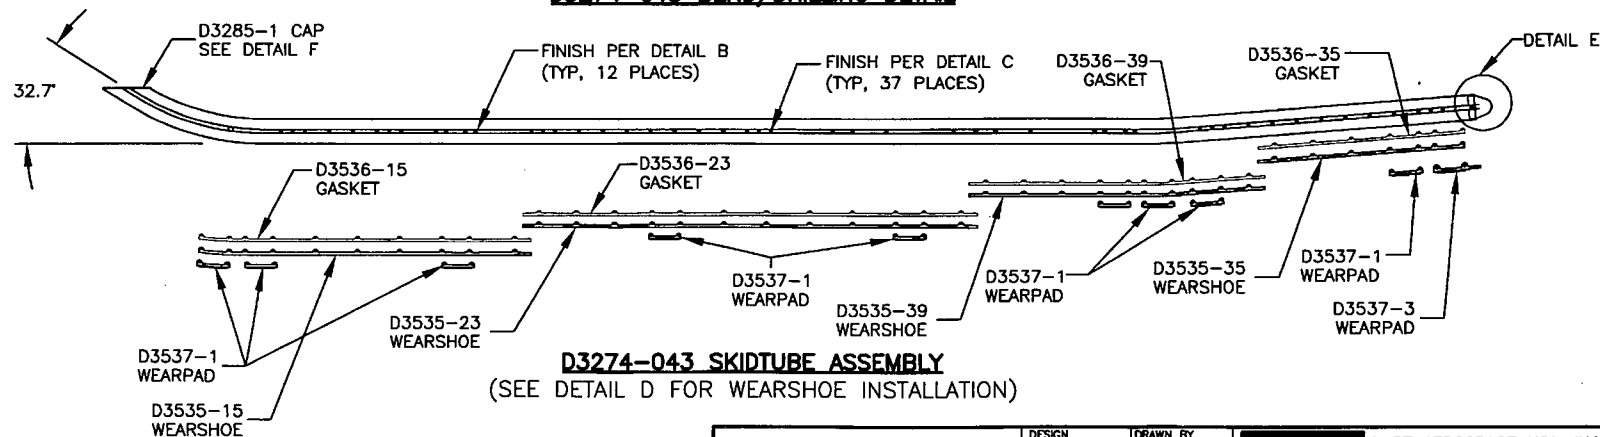

**D3274-043 SKIDTUBE ASSEMBLY**  
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

RELEASED  
NO. 17-02-12  
WORK ORDER  
NO. 158710  
WITHOUT NOTICE  
SUBJECT TO AMENDMENT  
CONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	CP	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	HA	APPROVED	HA	DRAWING NO.	REV. D
		DATE	06.12.19			D3274	SHEET 3 OF 4
				TITLE		SKIDTUBE ASSEMBLY	SCALE 1:15

Technical drawing of a circular cross-section of a pipe. The drawing shows a circle with four horizontal stiffeners. The stiffeners are labeled with a diameter of 0.375 (TYP). The distance between the stiffeners is 3.750, and the total width of the pipe is 5.000. A dimension of 1.250 is also shown.

D2649 SPACER

AFTER DRILL  
PERFORM THE  
HOLES ONLY

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.375  
HOLES ONLY:

1. CHAMFER HOLE 0.030x45°
2. INSERT D2649 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE TO Ø0.313x0.75 DEEP

**DETAIL D**

- ALS7-1032-130 INSERT (1)
- AN3C4A BOLT (1)
- AN960C10L WASHER (1)
- (78 PLACES)
- GASKET/WEARSHOE/WEARPAD (REF)

**DETAIL E**

AN3C4A BOLT (1)  
AN960C10L WASHER (1)  
NAS1515H3L WASHER (1)  
(2 PLACES)  
INSTALL WITH SIKAFLEX-241/-291

D2646 CAP  
SEAL WITH  
SIKAFLEX-241/291  
ADHESIVE

0.208 (2 PLACES)  
PRIOR TO INSTALLING  
D2646 CAP  
E. OUT END OF SKIDTUBE  
DEPTH AND 0.070 WALL

0.400

The diagram shows a cross-section of a skid tube with a cap being installed. A bolt and washers are used to secure the cap. The cap is labeled D2646. The adhesive is labeled SIKAFLEX-241/291. The drawing includes dimensions: 0.208 (2 PLACES) for the gap between the cap and the tube, 0.400 for the thickness of the cap, and 0.070 for the wall thickness of the skid tube. The text 'E. OUT END OF SKIDTUBE' and 'DEPTH AND 0.070 WALL' is also present.

AN4C5A BOLT (1)  
AN960C416 WASHER (1)  
INSTALL WITH SIKAFLEX-241/-291

CCR264SS3-3 RIVETS (2 PLACES)  
INSTALL WITH LPS-3

CR3212-4-03 RIVETS (2 PLACES)  
INSTALL WITH LPS-3

D3415-041 NUT PLATE,  
LPS-3 ON FAYING SURFACE, LPS HARDCOAT ON EXTERIOR

D3413-1 RING

D3285-1 CAP (REF)

1.0  
REMOVE RIDGE  
ON INSIDE OF  
SKIDTUBE LEAVE  
0.070 MIN.

1)  
ASHER (1)  
ASHER (1)  
SIKAFLEX-241/-291

ORIENTATION  
OF D3415-041

1/16

RELEASE  
07.02.01

**DETAIL F NOTES**

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D3285-1 (TRIM AS NEEDED)
4. WELD D3285-1 IN PLACE PER D
5. GRIND FLUSH
6. RIVET D3415-041 NUT PLATE IN

 


NOTE: MASK THREADS IN D3415-041

RELEASED  
07.02.12 #

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D3285-1 (TRIM AS NECESSARY)
4. WELD D3285-1 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D3415-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D3415-041  
PRIOR TO FINISH

NO. 415874  
DRILL WITH  
WORK ORDER  
PRIORITY  
SPECIAL  
FOR OUTSIDE  
TO 0.45 DEPTH  
AND 0.070  
ENGINERING  
R.D. TO  
SITE COPY  
STAMPED COPY  
AMENDMENT  
NOTICE

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.  THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	DESIGN	DRAWN BY	 <b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, MA	
	CHECKED	APPROVED		DRAWING NO.
	DATE	TITLE		SCALE
	CP	PH		
			D3274	
06.12.19			SKIDTUBE ASSEMBLY	
			1:3	

NO. 198

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barclay Elliott  
Job number: 47288A  
Part number: D206642545  
Description: 206 skid tube  
Welding Process: Tig ☒ Mig ☐  
Base material: Aluminum  
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual:  
Penetration:

pass ☒ fail ☐  
pass ☒ fail ☐

UNACCEPTABLE

Cracks:  
Undercut:  
Pin holes:  
Overlap (cold lap)  
Porosity (surface):  
Coloration:

pass ☒ fail ☐  
pass ☒ fail ☐  
pass ☒ fail ☐  
pass ☒ fail ☐  
pass ☒ fail ☐  
pass ☒ fail ☐

Qualifier P. D. D. Date of Test Coupon 09.04.27

Welder Barclay Elliott Date of Test Coupon 09.04.27

The above named individual is qualified in accordance with AWS D17.1.2001 to weld